



McElroy Manufacturing, Inc.

The leader by design.

Tulsa, Oklahoma U.S.A.

DRAWN:

MRH

CHECK:

SPA

APPR'D:

BWJ

DATE:

5/22/14

SHT

No: 1

REV

No: D

PART

No:


7800401

TALON™ 2000 INDEXER ASSEMBLY

NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

NOTES:

1. MOUNT 2X ITEM 30 CLOSEST TO CATWALK, THEN LOWER ITEM 1 INTO PLACE AND INSTALL 2X ITEM 30.
2. MOUNT ITEM 11 AFTER INSTALLING ITEM 1.
3. AFTER INSTALLING ITEM 4 MATCH DRILL Ø9/32 HOLES BETWEEN EACH SECTION AND CONNECT USING ITEMS 16, 25, AND 40.
4. APPLY 12" OF ITEM 31 TO THE TOP OF EACH LADDER RUNG.
5. FINAL ADJUSTMENT OF ITEM 9 TO BE DONE WITH INDEXER MOUNTED TO VEHICLE AND FACER CLAMPED IN THE CARRIAGE.
6. USE ITEMS 49, 50, 51, AND 52 TO INSTALL DRIP LINE FROM BOX TO EDGE OF INDEXER.

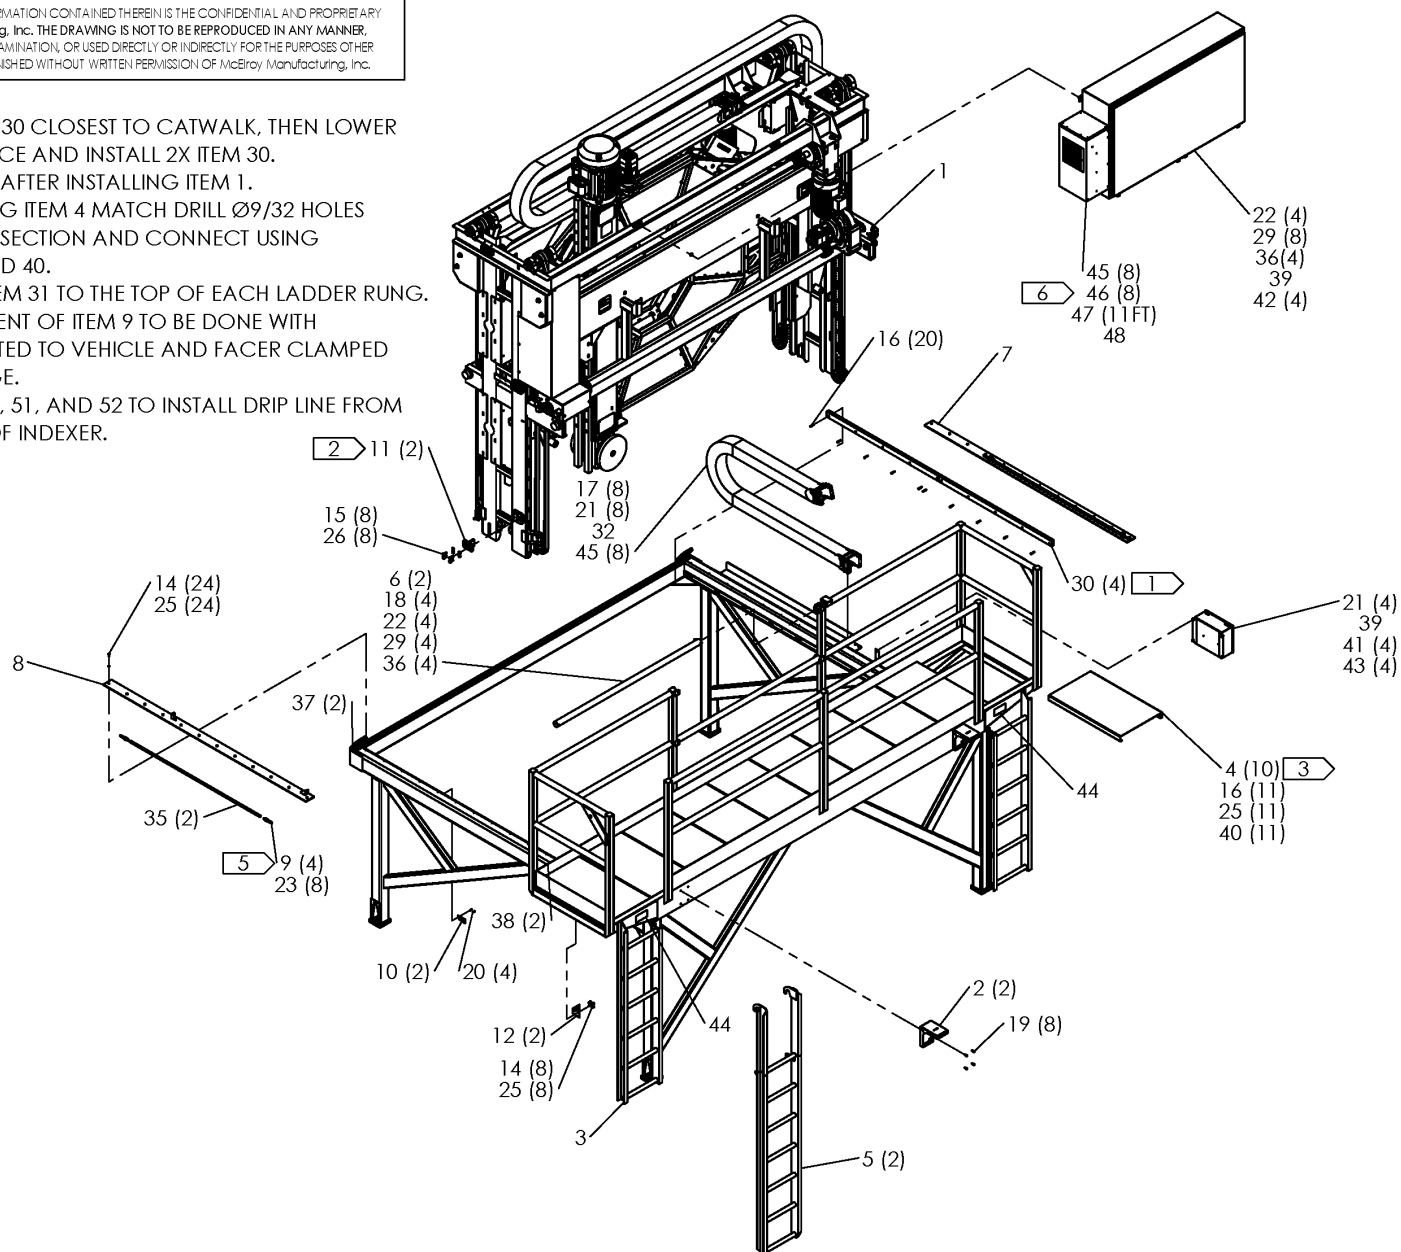

McElroy Manufacturing Parts List

Part Number: 7800401 Talon 2000 Indexer Assembly

Part Number 7800401 Component List

Item	Component	Description	Quantity	Unit	Price
1	7800402	Talon 2000 Indexer Movable Base Assembly	1.0	EA	0.00
2	7844801	Camera Bracket	2.0	EA	0.00
3	7813701	Indexer Fixed Base Wld	1.0	EA	0.00
4	7813901	Catwalk Grating	10.0	EA	0.00
5	7814001	Ext Ladder Wld	2.0	EA	0.00
6	7815801	Removable Rail	2.0	EA	0.00
7	7819801	Left Roller Guard Wld	1.0	EA	0.00
8	7819802	Right Roller Guard Wld	1.0	EA	0.00
9	7819901	Tensioner Rod	4.0	EA	190.00
10	7823501	Switch Indicator	2.0	EA	0.00
11	7826101	Vertical Stop Wld	2.0	EA	0.00
12	7840501	Indexer Stop	2.0	EA	0.00
14	MAB00003	1/4-20NCX3/4LG Hhcs	24.0	EA	0.31
15	MAB00080	1/2-13NCX1LG Hhcs GR8	8.0	EA	1.58
16	MAC00056	1/4-20NCX1-1/4LG Shcs PL	31.0	EA	1.18
17	MAC00075	5/16-18NCX1LG Shcs PL	8.0	EA	1.22
18	MAI00016	3/8-16NC X 3LG Crg Bolt	4.0	EA	0.00
19	MAL00007	1/4-20NCX3/4LG Hwh TF Screw	8.0	EA	0.49
20	MAL00009	#10-24NCX3/4LG Hwh TF Screw	4.0	EA	0.00
21	MBA00006	5/16-18NC Fnsh Hex Nut Stl PL	12.0	EA	0.33
22	MBA00007	3/8-16NC Fnsh Hex Nut Stl PL	8.0	EA	0.29
23	MBB00009	1/2-13NC Fnsh Jam Nut Stl PL	8.0	EA	0.59
25	MBE00005	1/4 Reg Splt Lck Washer Stl PL	51.0	EA	0.10
26	MBE00009	1/2 Reg Splt Lck Washer Stl PL	8.0	EA	0.18
29	MBF00007	3/8 TY 'a' Wide FL Wshr Stl PL	12.0	EA	0.11
30	MDM00469	Load Rail	4.0	EA	0.00
31	MJQ00556	Safe-t-wlk W/press Sens ADHX2"	26.0	FT	0.00
32	MLI00040	Indexer Cable Carrier	1.0	EA	0.00
35	A7843804	#40 Indexer Location Chain Kit	2.0	EA	896.00
36	MBE00007	3/8 Reg Splt Lck Wshr Stl PL	8.0	EA	0.12
37	MJQ00366	Blue Lift Point Label	4.0	EA	5.94
38	MJQ00379	Ylw, Blk Hook Lift Point Label	4.0	EA	6.90
39	7837201	Talon 2000 Indexer Electrical Power Assembly	1.0	EA	0.00
40	MBA00005	1/4-20NC Fnsh Hex Nut Stl PL	11.0	EA	0.32
41	MAB00032	5/16-18NCX3/4LG Hhcs	4.0	EA	0.44
42	MAB00064	3/8-16NCX1LG Hhcs	4.0	EA	0.51
43	MBE00006	5/16 Reg Splt Lck Wshr Stl PL	12.0	EA	0.11
44	8163275	DO Not Climb on Machine Label	2.0	EA	0.00
45	MAB00002	1/4-20NCX1/2LG Hhcs	8.0	EA	0.18
46	MLJ00071	1/2 Loop Clamp	8.0	EA	2.72
47	MHA00088	3/8IDX1/2OD Clear Tubing	11.0	FT	14.46
48	MHA00049	7/32 to 5/8 Hose Clamp	1.0	EA	4.28

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.