


NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

NOTES:

1. REMOVE HOSE PART NUMBER ID TAG.
2. TEFLON TAPE NOT REQUIRED.
3. REMOVE 8MSAE PLUG FROM SIDE OPPOSITE OF PUMP COMPENSATOR ADJUSTMENT AND INSTALL ITEM 7.

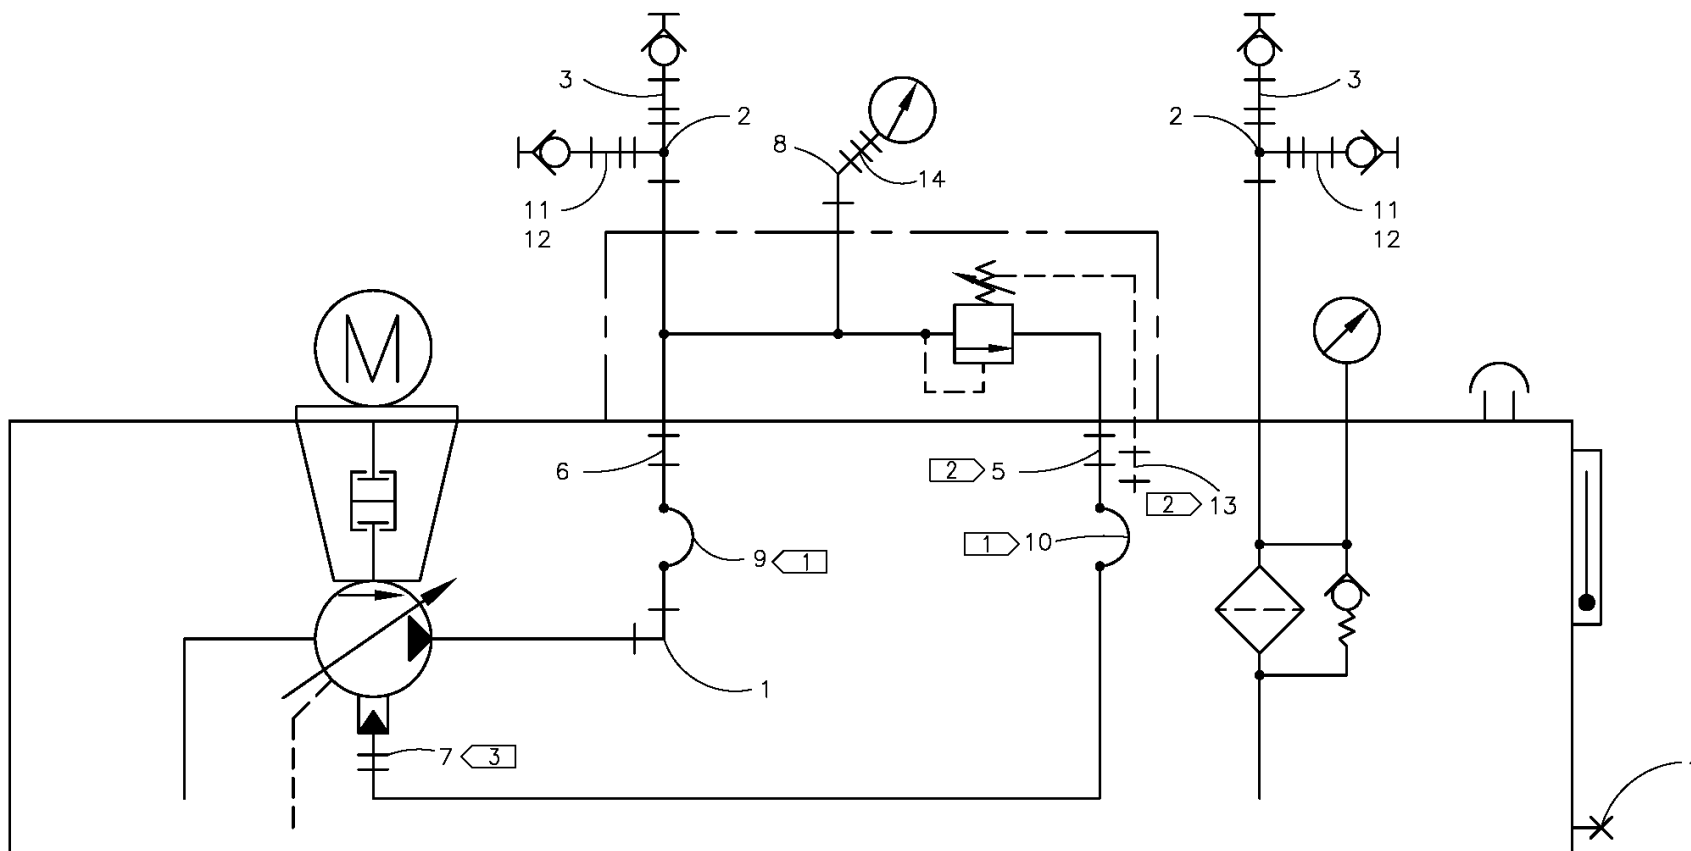

McElroy Manufacturing Parts List

Part Number: T1807001 EP1500P (PitBull) HPU Plumbing Schematic

Part Number T1807001 Component List

Item	Component	Description	Quantity	Unit	Price
1	MFQ00012	8MSL/8MSAE Elbow	1.0	EA	32.04
2	MFC00125	8MSAE/8FSAE/8FSAE Run Tee	2.0	EA	94.04
3	MFQ00004	8MSAE/8MSAE Adapter	2.0	EA	19.54
4	MFC00048	8MSAE Plug	1.0	EA	4.03
5	MFB00003	4MPT/4MJIC Adapter	1.0	EA	8.64
6	MFC00006	8MSAE/8MJIC Adapter	1.0	EA	6.93
7	MFC00050	8MSAE/4MJIC Adapter	1.0	EA	10.93
8	MFA00140	4MPT/4MPT Elbow (Effective 3/23/04 to 10/23/19)	1.0	EA	11.96
8	MFA00012	4MPT/4FPT Elbow 45	1.0	EA	16.08
9	SLCBEYE018	Hose Assy Oal 18"	1.0	EA	49.96
10	HABBDB014	Hose Assy Oal 14"	1.0	EA	65.63
11	MFC00027	8MSAE/6MJIC Adapter	2.0	EA	8.00
12	MDL00192	O-ring	2.0	EA	0.49
13	MFI00014	1/4NPTX5LG Nipple PL	1.0	EA	0.00
14	MFA00037	4FPT/4FPT Coupling	1.0	EA	0.00

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.