



McElroy Manufacturing, Inc.

The leader by design.

Tulsa, Oklahoma U.S.A.

DRAWN:

PJD

CHECK:

JBC

APPRVD:

DWP

DATE:

12/01/09

SHT

No: 1

REV

No: J

PART

No:


900801

DynaMc® 250 HAND PUMP ELECTRIC FACER ASSEMBLY 100/120V, 50/60Hz, 1Ph

NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

NOTES:

1. FILL CAVITY 2/3 FULL WITH EP GREASE.
2. INSTALL WITH MEDIUM STRENGTH THREAD LOCKING COMPOUND.
3. INSTALL WITH GASKET SEALER.
4. INSTALL WITH HIGH TEMPERATURE ANTI-SEIZE COMPOUND.
5. INSTALL WITH CYANOACRYLATE ADHESIVE.
6. ITEMS SHOWN IN PARENTHESIS REFLECT QUANTITIES IN A LOCAL GROUP AND MAY NOT INDICATE TOTAL ASSEMBLY QUANTITIES.
7. TORQUE TO 10 FT-LBS.
8. A. FOR BLADE SET ORDER 710606 WHICH INCLUDES (4) T1208601.
9. B. FOR ELECTRIC CORD ASSEMBLY ORDER MDB00124
10. C. FOR TOGGLE SWITCH ORDER MDB00123
11. D. FOR STRAIN RELIEF ORDER MDB00127

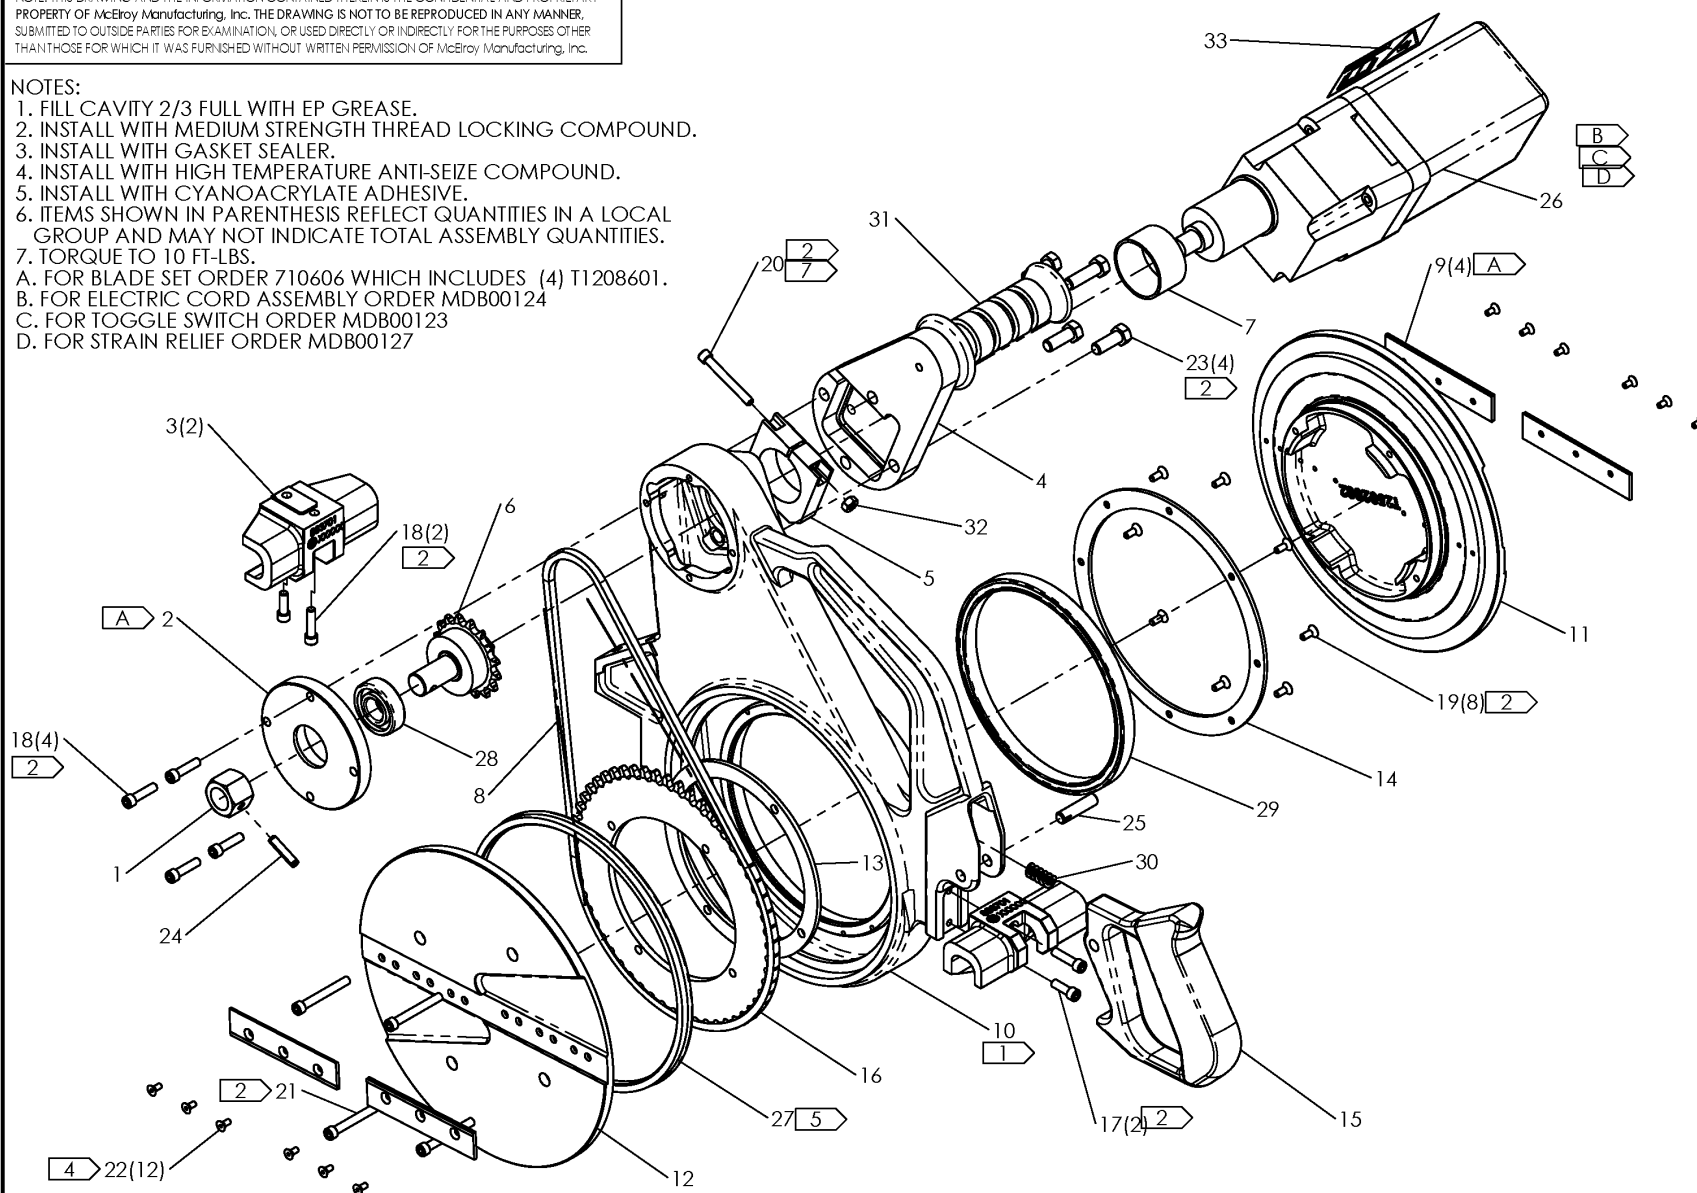

McElroy Manufacturing Parts List

Part Number: 900801 DynaMc 250 Hand Pump 100-120V, 50/60Hz, 1Ph Facer Assembly

Part Number 900801 Component List

Item	Component	Description	Quantity	Unit	Price
1	808802	Driver Sprocket Hex	1.0	EA	69.11
2	883401	Dynamc Elec Facer Bearing Cap	1.0	EA	168.00
3	883701	Dynamc 250 Guide Rod Bracket	2.0	EA	115.00
4	899501	Motor Adapter Plate Wld	1.0	EA	616.00
5	899601	Motor Retaining Block	1.0	EA	273.00
6	899701	Motor Drive Shaft Wld	1.0	EA	615.00
7	899801	Motor Spacer	1.0	EA	48.03
8	AT803501	Facer Roller Chain Assembly	1.0	EA	43.02
9	T1208601	4.63 LG Facer Blade	4.0	EA	118.00
9	710605	250 Pp-r Blade (Effective to 6/8/16)	4.0	EA	0.00
10	T802806	Facer Body (Effective to 4/6/10)	1.0	EA	1,844.00
10	T802807	Electric Facer Body	1.0	EA	1,844.00
11	T2502002	Tapped blade holder	1.0	EA	1,065.00
12	T2502003	Counterbored Blade Holder	1.0	EA	1,065.00
13	T803001	Bearing Spacer	1.0	EA	48.29
14	T803101	Bearing Retainer	1.0	EA	81.02
15	T803302	Latch Handle	1.0	EA	63.07
16	T803401	Driven Sprocket	1.0	EA	342.00
17	MAC00053	1/4-20NCX3/4LG Shcs PL	2.0	EA	0.49
18	MAC00055	1/4-20NCX1LG Shcs PL	6.0	EA	0.25
19	MAD00031	#10-24NCX1/2LG Fhscs	8.0	EA	0.39
20	MAC00435	1/4-20NCX2LG Shcs PL	1.0	EA	0.84
20	MAH00050	1/4-20NCX1/2LG Shcs SS (Effective to 4/6/10)	1.0	EA	0.52
21	MAH00051	1/4-20NCX1-3/4LG Shcs SS (Effective to 1/4/23)	4.0	EA	1.23
21	MAH00067	1/4-20NCX2LG Shcs SS	4.0	EA	1.14
22	MAH00074	#8-32NCX3/8LG Fhscs SS	12.0	EA	0.29
23	MAB00064	3/8-16NCX1LG Hhcs (Effective 4/7/10 to 8/28/25)	4.0	EA	0.51
23	MAN00009	3/8-16NCX1LG Shcs SS (Effective to 4/6/10)	4.0	EA	1.05
23	MAB00065	3/8-16NCX1-1/4LG Hhcs	4.0	EA	0.52
24	MCG00009	1/4DIAX1-1/8LG Roll Pin ZN PL	1.0	EA	0.73
25	MCK00073	3/8DIAX1-1/2LG Lock Pin Stl PL	1.0	EA	2.62
26	MDB00120	120V, 9A Universal Motor	1.0	EA	1,631.00
27	MDL00230	Seal	1.0	EA	129.00
28	MDM00027	Ball Bearing	1.0	EA	24.99
29	MDM00305	Bearing	1.0	EA	1,092.00
30	MJE00008	Die Spring	1.0	EA	6.69
31	MJJ00009	1" Black Gloss Hand Grip	1.0	EA	3.86
32	MBA00005	1/4-20NC Fnsh Hex Nut Stl PL	1.0	EA	0.32
33	410902	Danger Not Expln Proof Label	1.0	EA	1.80

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.