



McElroy Manufacturing, Inc.

The leader by design.

Tulsa, Oklahoma U.S.A.

DRAWN:

PJD

CHECK:

BOC

APPR'VD:

DWP

DATE:

12/11/09

SHT

No: 1

REV

No: E

PART


No: S03601

IN FIELD TENSILE TESTER ASSEMBLY

NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

NOTES:

1. FOR REPLACEMENT HANDLE ORDER MEA00122, FOR REPLACEMENT RUBBER KEEPER ORDER MEA00103, AND FOR REPLACEMENT HAND GRIP MJJ00037.
2. REMOVE HANDLE BY UNSCREWING FROM BASE OF HAND PUMP.

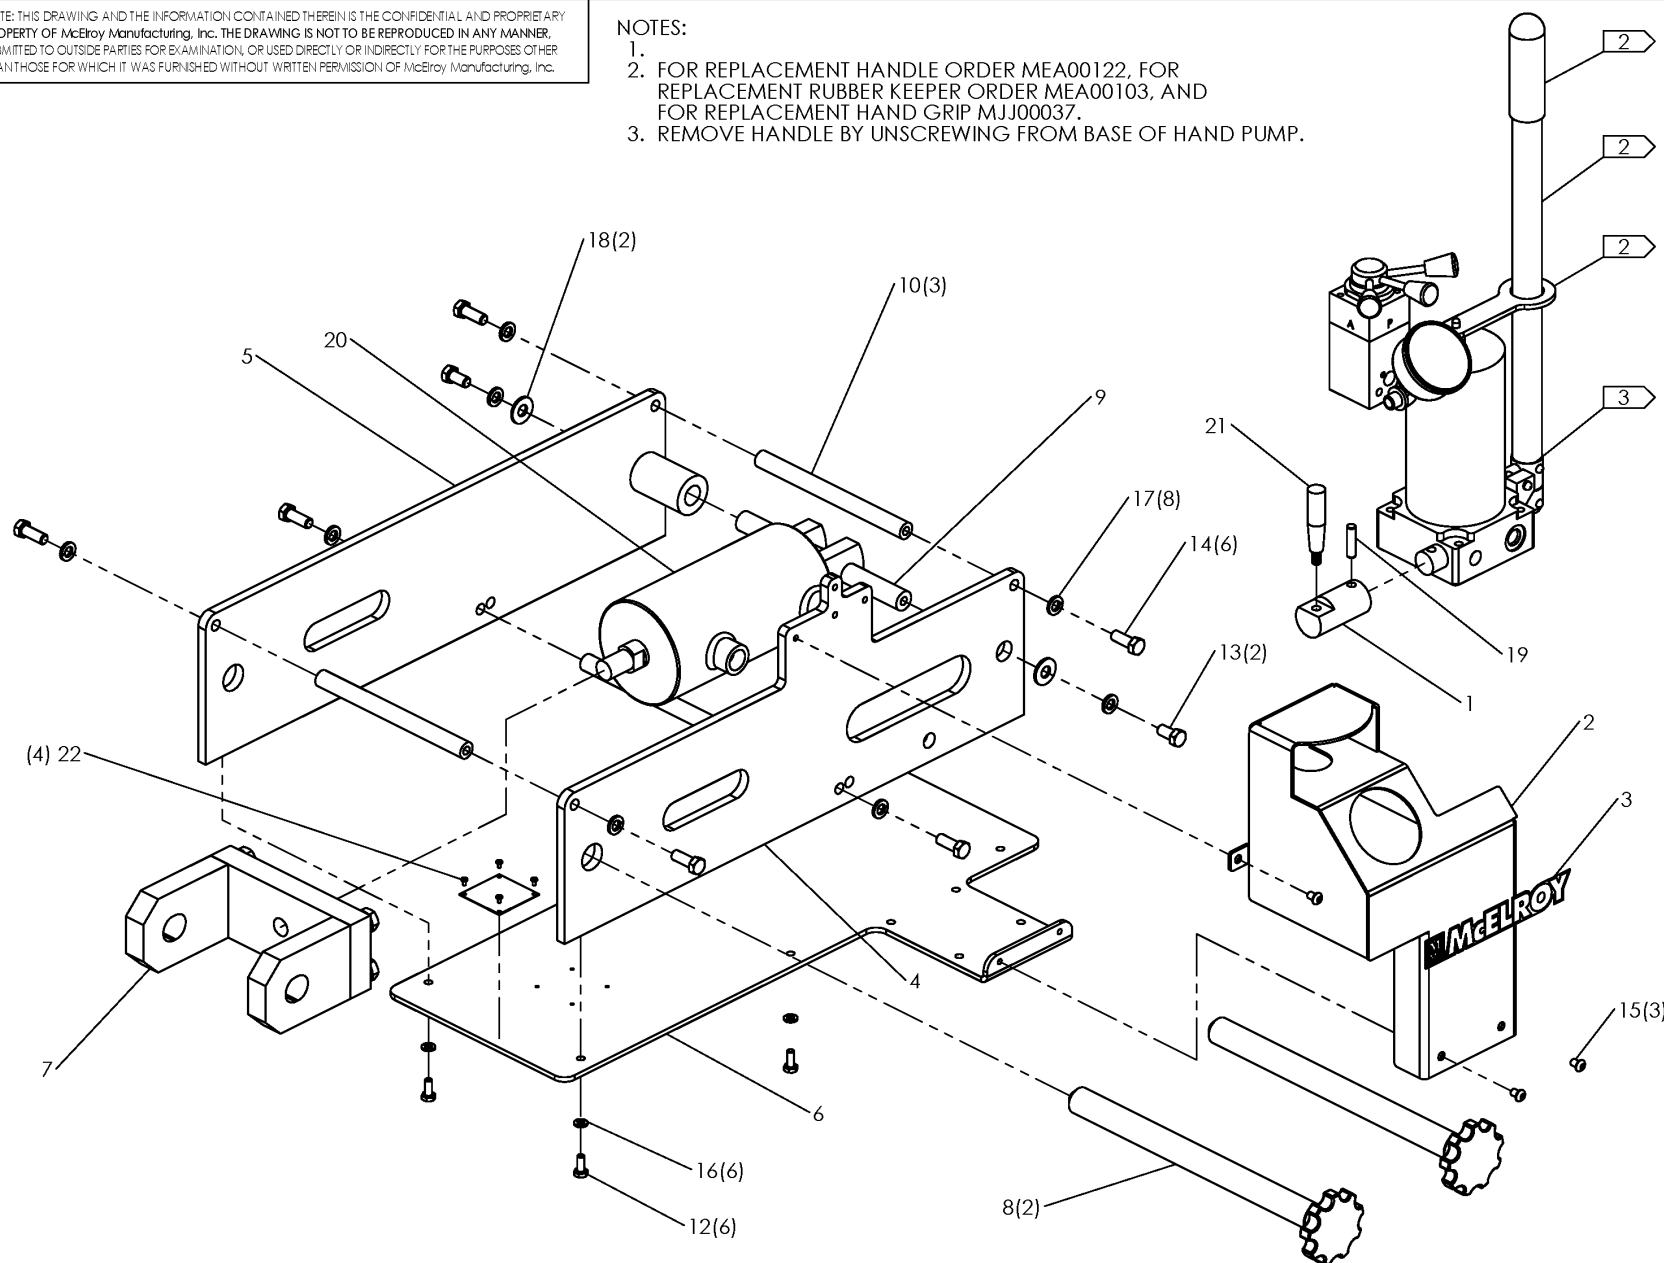

McElroy Manufacturing Parts List

Part Number: S03601 In Field Tensile Tester Assembly

Part Number S03601 Component List

Item	Component	Description	Quantity	Unit	Price
1	1263701	Dynamc HP Prs Rel Vlv Lvr Adpt	1.0	EA	91.01
2	1264101	Dynamc Valve & Gauge Plate Wld	1.0	EA	195.00
3	8163118	Small McElroy Branding Label	1.0	EA	5.18
4	S03701	Tensile Tester Pump Side Plate	1.0	EA	0.00
5	S03801	Tensile Tester Side Plate	1.0	EA	0.00
6	S03901	Tensile Tester Base Plate	1.0	EA	0.00
7	S04001	Tensile Tester Clevis Assy	1.0	EA	0.00
8	S04101	Tensile Tester Coupon Pin Assy	2.0	EA	398.00
9	S04201	Tensile Tester Cyl Pin	1.0	EA	0.00
10	S04301	Tensile Tester Standoff Handle	3.0	EA	0.00
11	S04401	Tensile Tester Hydraulic / Plumbing Schematic	1.0	EA	0.00
12	MAB00003	1/4-20NCX3/4LG Hhcs	6.0	EA	0.31
13	MAB00063	3/8-16NCX3/4LG Hhcs	2.0	EA	0.40
14	MAB00064	3/8-16NCX1LG Hhcs	6.0	EA	0.51
15	MAN00010	1/4-20NCX3/8LG Bhscs SS	3.0	EA	0.18
16	MBE00005	1/4 Reg Splt Lck Washer Stl PL	6.0	EA	0.10
17	MBE00007	3/8 Reg Splt Lck Wshr Stl PL	8.0	EA	0.12
18	MBF00007	3/8 TY 'a' Wide FL Wshr Stl PL	2.0	EA	0.11
19	MCG00040	5/16DIA X 1-1/4LG Roll Pin	1.0	EA	0.57
20	MEB00128	3-1/2B X 3S X 1R Hyd Cyl W/pin	1.0	EA	1,406.00
21	MJJ00045	M8 Handle	1.0	EA	37.88
22	MAH00093	#4-40NCX3/16LG Lock Scr	4.0	EA	0.32
23	MCH00021	3/4DIA X 2-11/16LG Hair Pin (Effective 5/17/10 to 9/13/13)	1.0	EA	1.98

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.