



McElroy Manufacturing, Inc.

The leader by design.

Tulsa, Oklahoma U.S.A.

DRAWN:

CRN

CHECK:

BWJ

APPR'VD:

DWP

DATE:

7/06/12

SHT

No:

2

REV

No:

C


PART

No:

T5049402

TracStar® 500 III AUTO FACER ASSEMBLY

NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

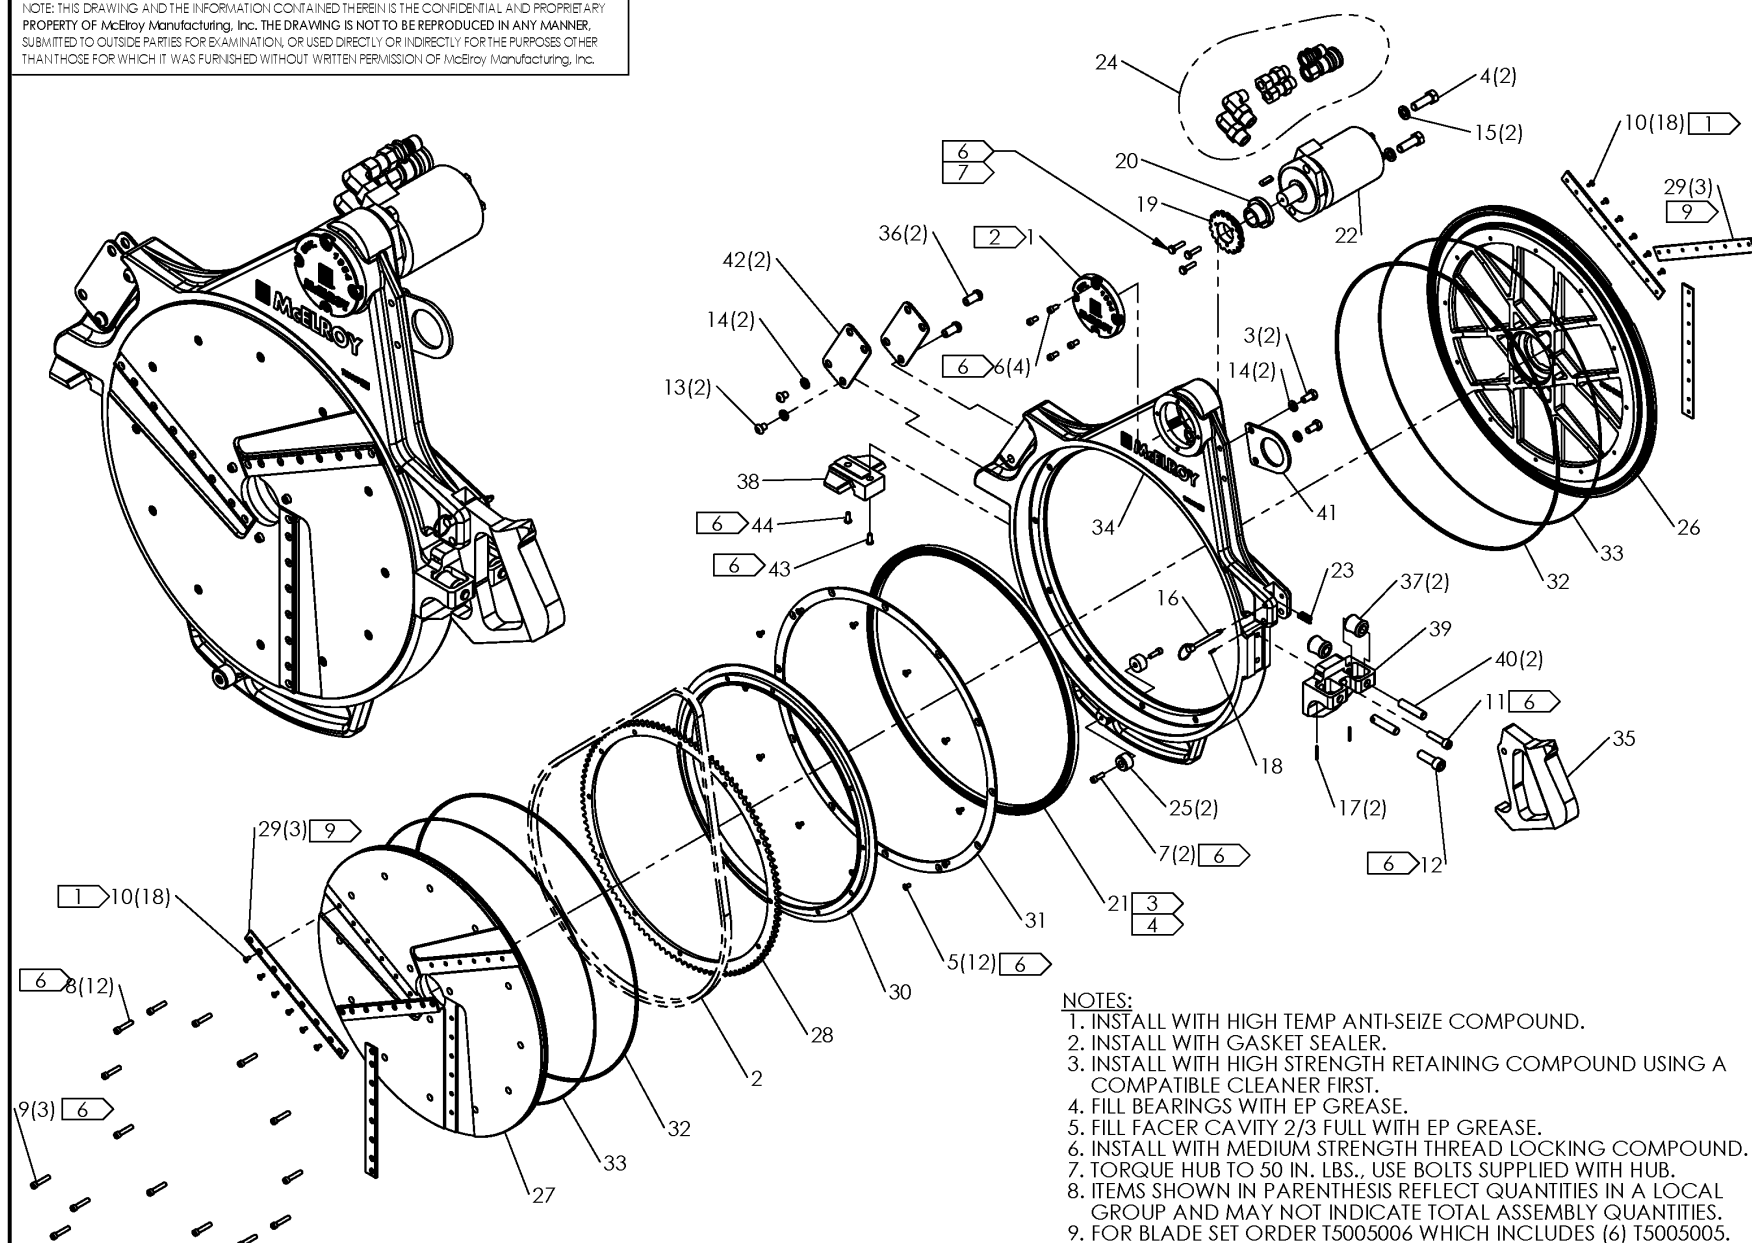

NOTES:

1. INSTALL WITH HIGH TEMP ANTI-SEIZE COMPOUND.
2. INSTALL WITH GASKET SEALER.
3. INSTALL WITH HIGH STRENGTH RETAINING COMPOUND USING A COMPATIBLE CLEANER FIRST.
4. FILL BEARINGS WITH EP GREASE.
5. FILL FACER CAVITY 2/3 FULL WITH EP GREASE.
6. INSTALL WITH MEDIUM STRENGTH THREAD LOCKING COMPOUND.
7. TORQUE HUB TO 50 IN. LBS., USE BOLTS SUPPLIED WITH HUB.
8. ITEMS SHOWN IN PARENTHESIS REFLECT QUANTITIES IN A LOCAL GROUP AND MAY NOT INDICATE TOTAL ASSEMBLY QUANTITIES.
9. FOR BLADE SET ORDER T5005006 WHICH INCLUDES (6) T5005005.

McElroy Manufacturing Parts List

Part Number: T5049402 TracStar 500 III Auto Facer Assembly

Part Number T5049402 Component List

Item	Component	Description	Quantity	Unit	Price
1	820203	Facer Cap	1.0	EA	115.00
2	AT5019801	Fcr Roller Chain Assy	1.0	EA	104.00
3	MAB00063	3/8-16NCX3/4LG Hhcs	2.0	EA	0.40
4	MAB00069	1/2-13NCX1-1/2LG Hhcs	2.0	EA	0.74
5	MAD00042	1/4-20NCX1/2LG Fhscs (Effective to 5/12/14)	12.0	EA	0.49
5	MAD00277	1/4-20NCX1/2LG Fhscs PL	12.0	EA	0.77
6	MAH00050	1/4-20NCX1/2LG Shcs SS	4.0	EA	0.52
7	MAH00052	1/4-20NC X 3/4"LG Shcs SS	2.0	EA	0.49
8	MAH00069	1/4-20NCX2-1/4LG Shcs SS	12.0	EA	1.11
9	MAH00072	1/4-20NCX1-1/2LG Shcs SS	3.0	EA	1.11
10	MAH00074	#8-32NCX3/8LG Fhscs SS	36.0	EA	0.29
11	MAH00078	3/8-16NCX1-1/2LG Shcs SS	1.0	EA	2.09
12	MAN00009	3/8-16NCX1LG Shcs SS (Effective to 12/13/12)	2.0	EA	1.05
12	MAC00093	3/8-16N X7/8LG Shcs PL	1.0	EA	1.65
13	MAN00044	3/8-16NCX1/2LG Bhscs SS	2.0	EA	0.67
14	MBE00007	3/8 Reg Splt Lck Wshr Stl PL	4.0	EA	0.12
15	MBE00009	1/2 Reg Splt Lck Washer Stl PL	2.0	EA	0.18
16	MCE00044	1/4DIA X2.25 Grip Detent Pin	1.0	EA	9.92
17	MCG00022	1/8DIA X1LG Roll Pin	2.0	EA	0.27
18	MCK00017	3/8DIA X1-3/4LG Lock Pin Stl PL	1.0	EA	3.45
19	MDF00018	#40JA17 Chain Sprocket	1.0	EA	45.54
20	MDH00019	1B, Ja, QD Hub	1.0	EA	30.65
21	MDM00032	18ID X19OD X0.5HT Ball Bearing	1.0	EA	2,428.00
22	MEC00004	1"SHT,1/4K,11.9CID Hyd Mtr	1.0	EA	689.00
23	MJE00008	Die Spring	1.0	EA	6.69
24	T5001103	TracStar 500 II Coach Equipped Facer Hydraulic/Plumbing Schematic	1.0	EA	0.00
25	T5004101	Bottom Rest Button	2.0	EA	38.24
26	T5004602	Tapped Blade Holder	1.0	EA	3,513.00
27	T5004603	C'bored Blade Holder	1.0	EA	3,513.00
28	T5004801	Driven Sprocket	1.0	EA	767.00
29	T5005005	T500II Facer Blade 10.25LG	6.0	EA	132.00
30	T5005201	Fcr Spacer Ring	1.0	EA	844.00
31	T5005301	Fcr Bearing Clamp Ring	1.0	EA	639.00
32	T5005401	Fcr Body Seal	2.0	EA	202.00
33	T5005402	Fcr Body O'ring	2.0	EA	20.50
34	T5008704	Facer Body	1.0	EA	4,315.00
35	T5008803	Fcr Latch Handle	1.0	EA	361.00
36	T5047901	Shoulder Nut	2.0	EA	95.78
37	T5048501	Roller	2.0	EA	144.00
38	T5049601	Facer Guide Rod Bracket Kit (Effective to 12/13/12)	1.0	EA	171.00
38	T5049602	Facer Guide Rod Bracket	1.0	EA	181.00
39	T5049701	Facer Roller Housing	1.0	EA	867.00
40	T5049901	Facer Roller Pin	2.0	EA	148.00
41	T5050001	Facer Lifting Lug	1.0	EA	19.63
42	T5051701	Splice Plate	2.0	EA	27.83
43	MAN00056	3/8-16NCX1-1/2LG Bhscs SS	1.0	EA	2.09
44	MAH00070	3/8-16NCX1LG Bhscs SS	1.0	EA	0.92

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.